# **Excellent Integrated System Limited**

Stocking Distributor

Click to view price, real time Inventory, Delivery & Lifecycle Information:

Honeywell Sensing and Productivity Solutions SX30A

For any questions, you can email us directly: <a href="mailto:sales@integrated-circuit.com">sales@integrated-circuit.com</a>



Datasheet of SX30A - SENSOR HI-IMP 30PSIA BUTN PKG

Contact us: sales@integrated-circuit.com Website: www.integrated-circuit.com



Representative photograph, actual product appearance may vary.

Due to regional agency approval requirements, some products may not be available in your area. Please contact your regional Honeywell office regarding your product of choice.

### SX30A

Pressure Sensors: Measurement Type: Absolute; 0 psia to 30 psia, Unamplified, Button Package - No Port

#### **Features**

- Low Cost
- High-Impedance Bridge
- Absolute and Differential (Gauge)
- Low Noise
- Low Power Consumption for Battery Power

### **Typical Applications**

- Medical
- Instrumentation
- Barometric
- Measurement
- Pneumatic Controls
- Battery Powered Equipment

### **Description**

The SX Series pressure sensors provide the lowest cost components for measuring pressures up to 150 psi. These sensors are designed for use with non-corrosive, non-ionic media, such as air and dry gases. Convenient pressure ranges are available to measure differential, gauge, and absolute pressures from 0 psi to 1 psi (SX01) up to 0 psi to 150 psi (SX150).

The Absolute (A) devices have an internal vacuum reference and an output voltage proportional to absolute pressure. The differential (D) devices allow application of pressure to either side of the diaphragm and can be used for gauge or differential pressure measurements.

This product is packaged in either the standard low cost chip carrier "button" package, a plastic ported "N" package, or a DIP package.

 $file: ///CI/Documents \% 20 and \% 20 Settings/rabab/Desktop/Datasheet \% 20--\% 20 SX 30 A. htm (1 of 5) 15/03/2005 02:54:33\ \tilde{a}_{1}/20 A. htm (1 of 5) 15/03/2005 02:54:33\ \tilde{a}_{2}/20 A. htm (1 of 5) 15/03/2000 02:54:33\ \tilde{a}_{2}/2$ 



# Distributor of Honeywell Sensing and Productivity Solutions: Excellent Integrated System Datasheet of SX30A - SENSOR HI-IMP 30PSIA BUTN PKG

Contact us: sales@integrated-circuit.com Website: www.integrated-circuit.com

All packages are designed for applications where the sensing element is integral to the OEM equipment. These packages can be oring sealed, epoxied, and/or clamped onto a pressure fitting. A closed-bridge four pin SIP configuration is provided for electrical connection to the "Button" or "N" Package. The DIP Package mounts on a PC board like a standard IC with through-hole pins. This extremely small size package enables the use of multiple sensors in applications with limited space.

# Honeywell

#### SX30A

Pressure Sensors: Measurement Type: Absolute; 0 psia to 30 psia, Unamplified, Button Package - No Port

Product Specifications	
Measurement Type	Absolute
Signal Conditioning	Unamplified
Pressure Range	0 psia to 30 psia
Maximum Overpressure	90 psia
Supply Voltage	12 Vdc max.
Compensated	No
Output Calibration	No
Response Time	100 μS
Termination	PCB
Port Style	No Port
Package Style	Button
Typical Sensitivity	0.75 mV/V/psi
Full Scale Span	75 mV min., 110 mV typ., 150 mV max.
Zero Pressure Offset	-35.0 mV min., -20.0 mV typ., 0.0 mV max.
Linearity, Repeatability & Hysteresis Error	- 0.5 min., 0.2 typ., 0.5 max. % Full Scale Span
Repeatability	0.5 % span
Input Resistance	4.1 kOhms typ.
Output Resistance	4.1 kOhms typ.

 $file: ///CI/Documents \% 20 and \% 20 Settings/rabab/Desktop/Datasheet \% 20-\% 20 SX 30 A. htm (2 of 5) 15/03/2005 02:54:33\ \tilde{a} = 1.00 A. htm$ 



Datasheet of SX30A - SENSOR HI-IMP 30PSIA BUTN PKG

Contact us: sales@integrated-circuit.com Website: www.integrated-circuit.com

ciccionic components	
Operating Temperature Range	-40 °C to 85 °C [-40 °F to 185 °F]
Storage Temperature Range	-55 °C to 125 °C [-67 °F to 257 °F]
Media Compatibility	Clean, dry gases only
UNSPSC Code	411121
UNSPSC Commodity	411121 Transducers
Comment	Lead Temperature Soldering 2 s to 4 s at 250 °C [482 °F]
Availability	Global
Series Name	SX Series

# Honeywell

### SX30A

Pressure Sensors: Measurement Type: Absolute; 0 psia to 30 psia, Unamplified, Button Package - No Port


 $file: ///C/Documents \% 20 and \% 20 Settings/rabab/Desktop/Datasheet \% 20 -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} -- \% 20 SX 30 A. htm (3 of 5) 15/03/2005 \ 02:54:33 \ 02:$ 



Datasheet of SX30A - SENSOR HI-IMP 30PSIA BUTN PKG

Contact us: sales@integrated-circuit.com Website: www.integrated-circuit.com

## For Reference Only mm (in)

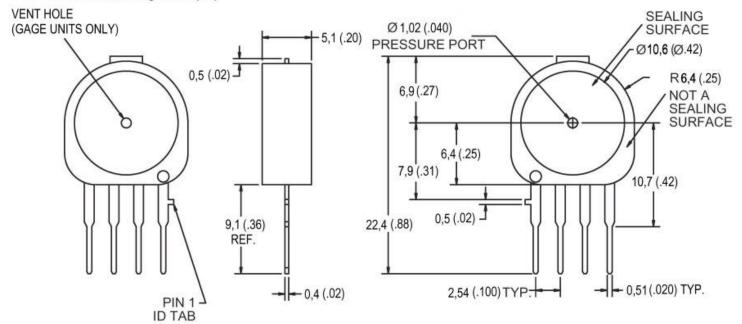

# Honeywell

#### SX30A

Pressure Sensors: Measurement Type: Absolute; 0 psia to 30 psia, Unamplified, Button Package - No Port

[Electrical Connections]

# **Honeywell**

## SX30A

 $file: ///C/Documents \% 20 and \% 20 Settings/rabab/Desktop/Datasheet \% 20 -- \% 20 SX 30 A.htm (4 of 5) 15/03/2005 \ 02:54:33 \ \tilde{a} = 1.00 A.htm (4 of 5) 15/0$ 



Datasheet of SX30A - SENSOR HI-IMP 30PSIA BUTN PKG

Contact us: sales@integrated-circuit.com Website: www.integrated-circuit.com

Pressure Sensors: Measurement Type: Absolute; 0 psia to 30 psia, Unamplified, Button Package - No Port

[Equivalent circuit]

# Honeywell

#### SX30A

Pressure Sensors: Measurement Type: Absolute; 0 psia to 30 psia, Unamplified, Button Package - No Port

## **A** WARNING

#### **PERSONAL INJURY**

DO NOT USE these products as safety or emergency stop devices, or in any other application where failure of the product could result in personal injury.

Failure to comply with these instructions could result in death or serious injury.

## **A** WARNING

### MISUSE OF DOCUMENTATION

- The information presented in this product sheet (or catalog) is for reference only.
  DO NOT USE this document as product installation information.
- Complete installation, operation and maintenance information is provided in the instructions supplied with each product.

Failure to comply with these instructions could result in death or serious injury.

 $@\ Copyright\ Honeywell\ Inc. 1998-2004\ All\ rights\ reserved.$ 

file:///Cl/Documents%20and%20Settings/rabab/Desktop/Datasheet%20--%20SX30A.htm (5 of 5)15/03/2005 02:54:33 ã