

Excellent Integrated System Limited

Stocking Distributor

Click to view price, real time Inventory, Delivery & Lifecycle Information:

[Omron Automation & Safety](#)
[Z49-C6 2M](#)

For any questions, you can email us directly:

sales@integrated-circuit.com

OMRON

Parallel Beam Line Sensor

Z4LC



Visible RED Class II Laser Width/Profile Measurement Sensor Offers High Speed, Precision Object Measurement and Multiple-Mode Operation for Positioning and Size Discrimination

- FDA Class II IEC Class I visible RED laser emitter and CCD receiver ensure high performance
- 10-micron resolution
- 28-mm beam width
- 40 mm fixed or 0 to 300 mm sensing distance
- 4 to 20 mA 12 bit binary/RS-232C analog outputs
- 3-level discrimination outputs: NPN
- 5 input functions
- 9 measurement modes, including edge detection of clear material



Ordering Information

■ SENSOR

Sensing distance	Measurement width	Type	Part number
 40 mm	28 mm	Integrated type	Z4LC-S2840
 0 to 300 mm	28 mm	Separate type	Z4LC-S28

■ CONTROLLER

Controller	Type	Part number
	NPN model	Z4LC-C28

■ EXTENSION CABLE

Extension cable for emitter and receiver	Cable length	Part number
	2 m	Z49-C6 2M
	8 m	Z49-C6 8M

Z4LC ————— OMRON ————— Z4LC

Specifications

■ SENSOR

Item	Z4LC-S2840	Z4LC-S28
Light source	Visible-light semiconductor laser diode (wavelength: 670 nm, JIS Class 1, IEC Class I, FDA Class II)	
Measurement width	28 mm	
Sensing distance	40 mm	0 to 300 mm
Min. sensing object	0.2 mm dia.	0.5 mm dia.
Linearity (See Note 1, 2.)	±0.1% F.S.	
Temperature drift (see note 1)	0.01% F.S./°C max.	
Ambient temperature	Operating: 0 to 40°C (32°F to 104°F) with no icing or condensation Storage: -15 to 50°C (5°F to 122°F) with no icing or condensation	
Ambient humidity	Operating/Storage: 35 to 85% (with no condensation)	
Ambient illuminance	Incandescent lamp: 1,000 lux max.	
	Sunlight: 3,000 lux max.	
Vibration resistance	10 to 150 Hz half-amplitude of 0.75 mm or acceleration of 100 m/s ² (whichever is smaller)	
Degree of protection	IEC60529, IP40	
Material	Diecast aluminum	
Cable length	2 m	
Weight	Approx. 520 g (including a 2-m cable)	Emitter: Approx. 250 g Receiver: Approx. 250 g (including a 2-m cable)

Note: 1. The values given are typical values for *one-side interruption mode 1* (with the distance between an emitter and a receiver set to 40 mm and the target placed 20 mm from the receiver).

2. Linearity: The value deviated from the ideal straight line of measurement value outputs in *one-side interruption mode 1* (when the distance between an emitter and a receiver is set to 40 mm, and the target is placed 20 mm from the receiver).

■ CONTROLLER

Item	Z4LC-C28		
Display	7-segment LED, 4 digits		
Minimum reading	10 μm		
Repeatability (See Note 1, 2.)	20 μm (process value for averaging: 16)		
Measurement value output	Analog	Output form	4 to 20 mA, load impedance: 300 Ω max.
		Response time	3.3 ms (process value for averaging: 1)
	Digital	Output form	12-bit binary output NPN open collector output: 30 VDC, 20 mA max. Residual voltage: 2 V max.
		1 digit (See Note 3.)	10 μm
		Response time	3.3 ms (process value for averaging: 1)
Output signals	Discrimination output (HI, PASS, LOW)		NPN open collector output 30 VDC 20 mA max. Residual voltage 2 V max.
Input signals	Enable input LD OFF input Bank switch input Forced zero input External reset input		Photocoupler input Input voltage: 12 to 24 VDC±10% ON voltage: 10.2 VDC min. OFF voltage: 3.0 VDC max. Input current: 10 mA (Typ.)
Communications	RS-232C		
Temperature drift	0.005% F.S./°C		
Power supply voltage	24 VDC +10% -15%, ripple (p-p): 10% max.		
Current consumption	0.4 A max.		
Main functions	Measurement value display, measurement mode selection, discrimination value setting selection, number of process values to average selection, forced zero function, bank number selection, linear output range setting, enable mode measurement.		

This table (with applicable Notes) continues on the next page.

Z4LC ————— OMRON ————— Z4LC

Table continued from previous page

Item	Z4LC-C28
Ambient temperature	Operating: 0 to 50°C (32°F to 122°F) with no icing or condensation Storage: -15 to 60°C (5°F to 140°F) with no icing or condensation
Ambient humidity	Operating/Storage: 35 to 85% (with no condensation)
Vibration	10 to 150 Hz half-amplitude of 0.15 mm or acceleration of 20 m/s ² (whichever is smaller)
Degree of protection	IEC60529, IP20
Material	ABS/PC
Weight	Approx. 290 g

- Note:** 1. The values given are typical values for *one-side interruption mode 1* (with the distance between an emitter and a receiver set to 40 mm and the target placed 20 mm from the receiver).
 2. The repeatability is the variation in the display and digital output when the target is stationary. Performance specifications may not be satisfied if the environment is altered adversely (e.g., if there is a strong magnetic field).
 3. The value converted to a distance corresponding to the 1LSB of the digital output.

Communications Specifications

Electric Characteristics	RS-232C
Synchronization	Stop-start (asynchronous)
Baud rate	1200, 2400, 4800, 9600, 19200 bps
Data length	7, 8-bit ASCII
Parity	Even, Odd, None
Stop bit	1-bit, 2-bit
Header/Footer	CR, CR+LF, STX+ETX
Output data	Measurement data, error messages, setting conditions output
Input commands	Measurement mode selection, forced zero, etc.

Z4LC

OMRON

Z4LC


Explanation of Each Mode

■ MEASUREMENT MODES

Select one of the following measurement modes according to the measurement conditions.


(1.) One-side Interruption Mode 1 (First Dark Edge)

Measures the width from the edge of the beam to the end of the first dark section. (For meander detection, orientation flat positioning, etc.)

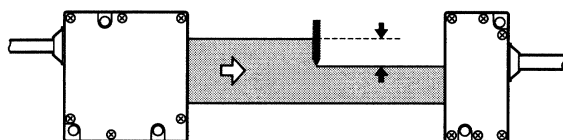


(2.) One-side Interruption Mode 2 (First Light Edge)

Measures the width from the edge of the beam to the end of the first light section. (For gap measurement, etc.)

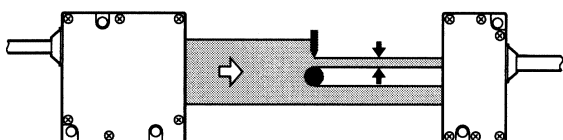


(3.) Bar Diameter Measurement Mode (Diameter)

Measures the width from the first edge to the last edge of the beam. (For measuring the diameter of bars, etc.)

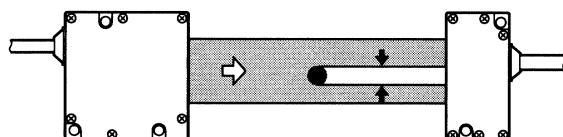


(4.) Bar Position Measurement Mode (Position)

Measures the center point between the first edge and the last edge of the beam. (For position detection of bars, etc.)

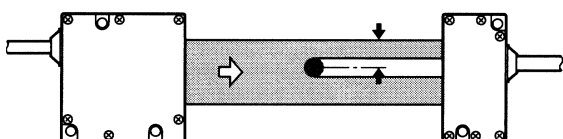


(5.) Pin Pitch Determination Mode (Pin Pitch)

Measures the pin pitch and determines if pins are centered or not. It is passed if all pin pitch are within the tolerance and rejected if not. (Pin number: 14 max.)

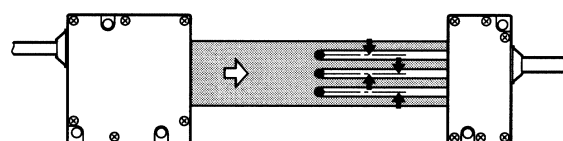


(6.) Pin Diameter Determination Mode (Pin Diameter)

Determines whether pin diameters are within a set range. (Pin number: 14 max.)

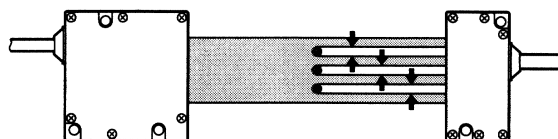


(7.) Specified Edge Measurement Mode (Edge)

Measures the width of two specified edges.

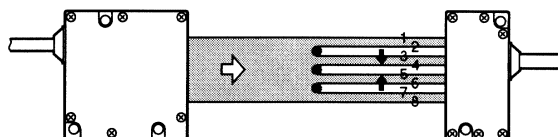


(8.) Wire Position Detection Mode (Fine Line)

Measures the position of fine lines with minimum of 0.1 dia. The measurement details are the same as that of bar position measurement mode. (For positioning of wires more than 0.1 dia.)

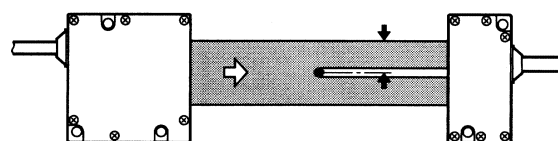

(9.) Transparent Object Edge Detection Mode (Glass)

Detects the edge of glass boards and transparent sheets. The distance between the upper edge of the beam and the edge of the transparent object is measured. (For detecting edges of transparent objects.)

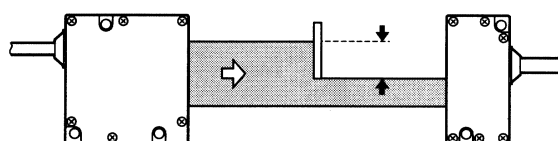

Forced Zero Function

The displayed value can be set to zero by the ZERO/ENT Key on the front panel or external input.

Suitable for the discrimination of standard workpieces.

Analog Output Setting Function

The range of analog output can be set within the measurement width 28 mm.

Enable Mode Measurement Function

The processing item (i.e. maximum, minimum, maximum minus minimum, or average) can be set. The set item is calculated and output while the enable mode signal is input.


Suitable for the measurement of bar movement.

Z4LC ————— OMRON ————— Z4LC

Nomenclature


■ SENSORS

Z4LC-S2840
Z4LC-S28 (Link has been omitted.)

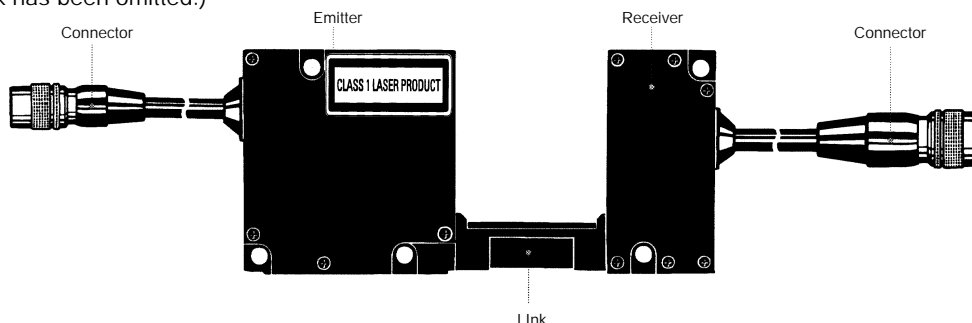

■ CONTROLLER

Z4LC-C28

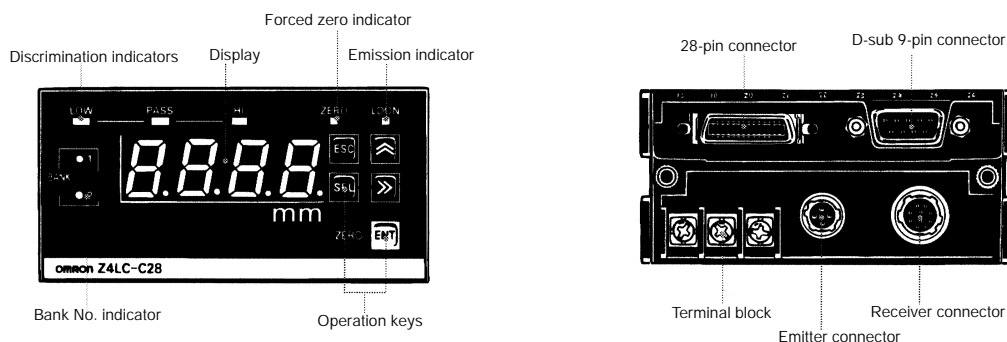

Operation

■ INPUT/OUTPUT SPECIFICATIONS

I/O Signals

I/O	Signals	Specifications
Input Signals	Enable input (ENABLE)	Photocoupler input
	LD OFF input (LD-OFF)	Input voltage: 12 to 24 VDC±10%
	Bank switch input (BANK)	ON voltage: 10.2 VDC min.
	Forced zero input (ZERO)	OFF voltage: 3.0 VDC max.
	External reset input (EXRESET)	Input current: 10 mA (Typ.)
Output Signals	Discrimination output (HI, PASS, LOW) Error output (ERR)	NPN open collector output: 30 VDC, 20 mA max. Residual voltage: 2 V max.
Binary Data Output	D0 to D11, STB	NPN open collector output: 30 VDC, 20 mA max. Residual voltage: 2 V max.


Z4LC

OMRON

Z4LC

■ TERMINAL CONNECTIONS

Z4LC-C28 (Rear Section)

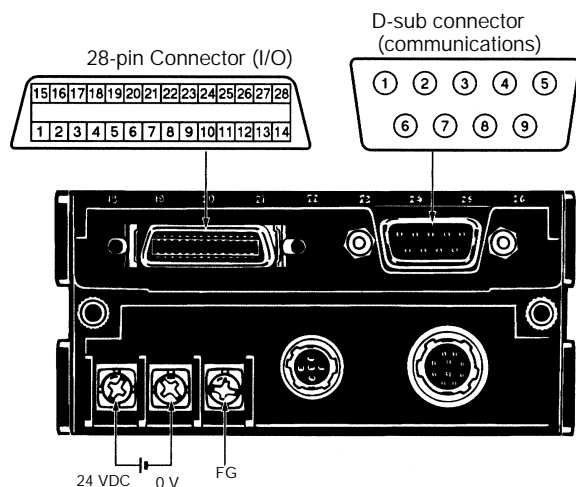

28-pin Connector (I/O)

Pin No.	Signals
1	Output COM
2	$\overline{D0}$ (LSB)
3	D2
4	D4
5	D6
6	D8
7	D10
8	STB
9	PASS
10	ERR
11	ZERO
12	ENABLE
13	Input COM
14	Linear Output GND
15	Output COM
16	D1
17	D3
18	D5
19	D7
20	D9
21	$\overline{D11}$ (MSB)
22	HI
23	LOW
24	LD-OFF
25	BANK
26	EXRESET
27	Input COM
28	Linear Output

D-sub Connector (Communications)

Pin No.	Signals
1	N.C
2	RD
3	SD
4	N.C
5	SG
6	N.C
7	N.C
8	N.C
9	N.C

Note: Pins 4 and 6, and pins 7 and 8 are respectively connected internally.


Z4LC

OMRON

Z4LC


■ INPUT/OUTPUT CIRCUIT

Input Circuit

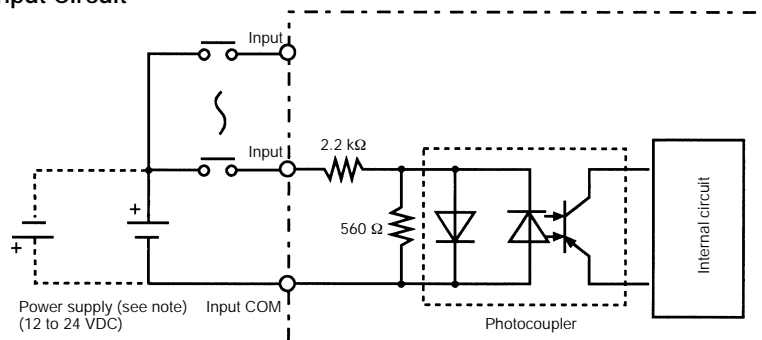

Note: There is no need to be concerned about the polarity of power supply.

Output Circuit

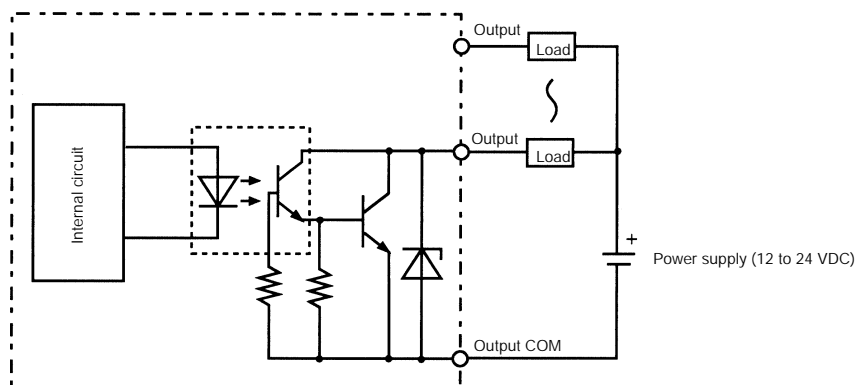

Z4LC

OMRON


- Z4LC

Dimensions

Unit: mm (inch)



■ CONTROLLER

Z4LC-C28

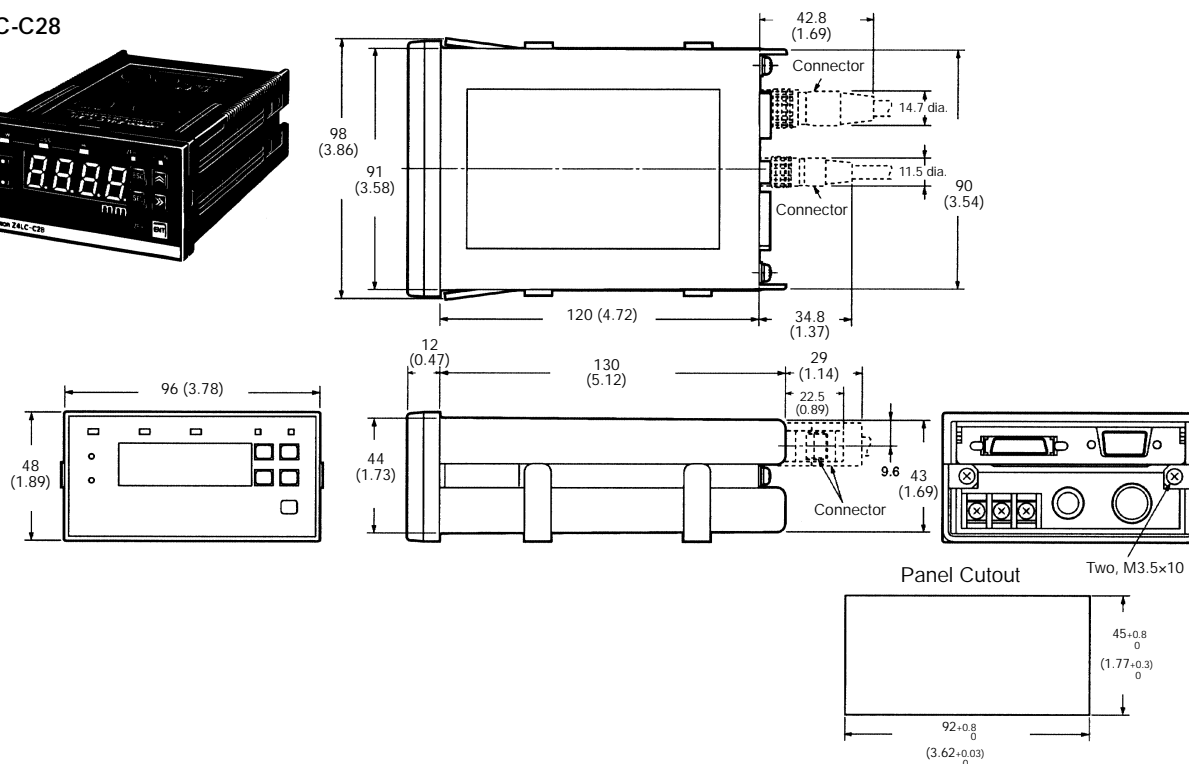

■ SENSORS

Z4LC-S2840

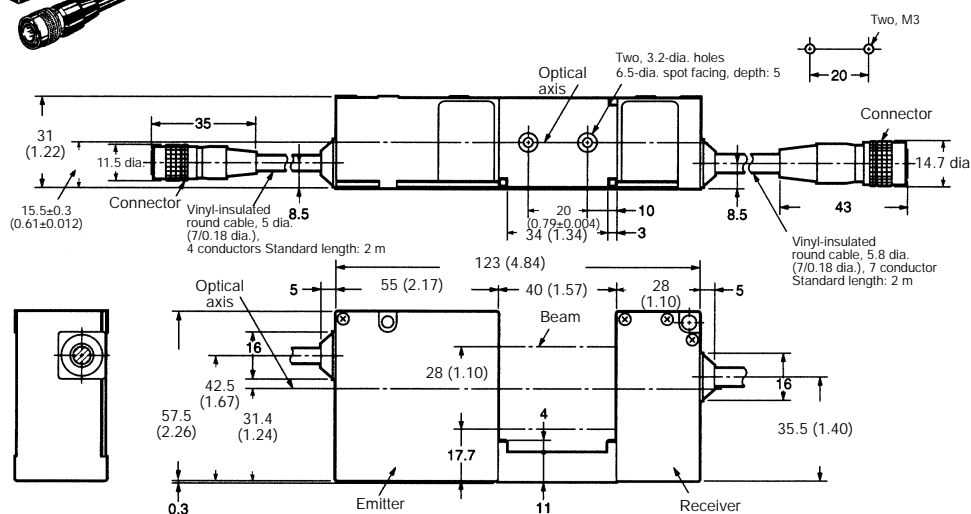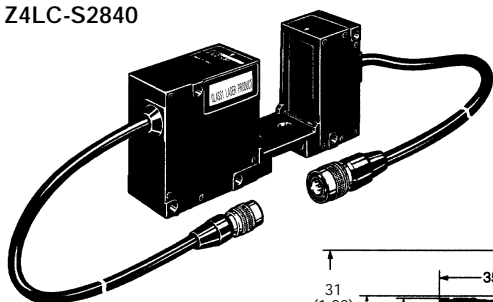


Z4LC

OMRON

Z4LC

Z4LC-S28

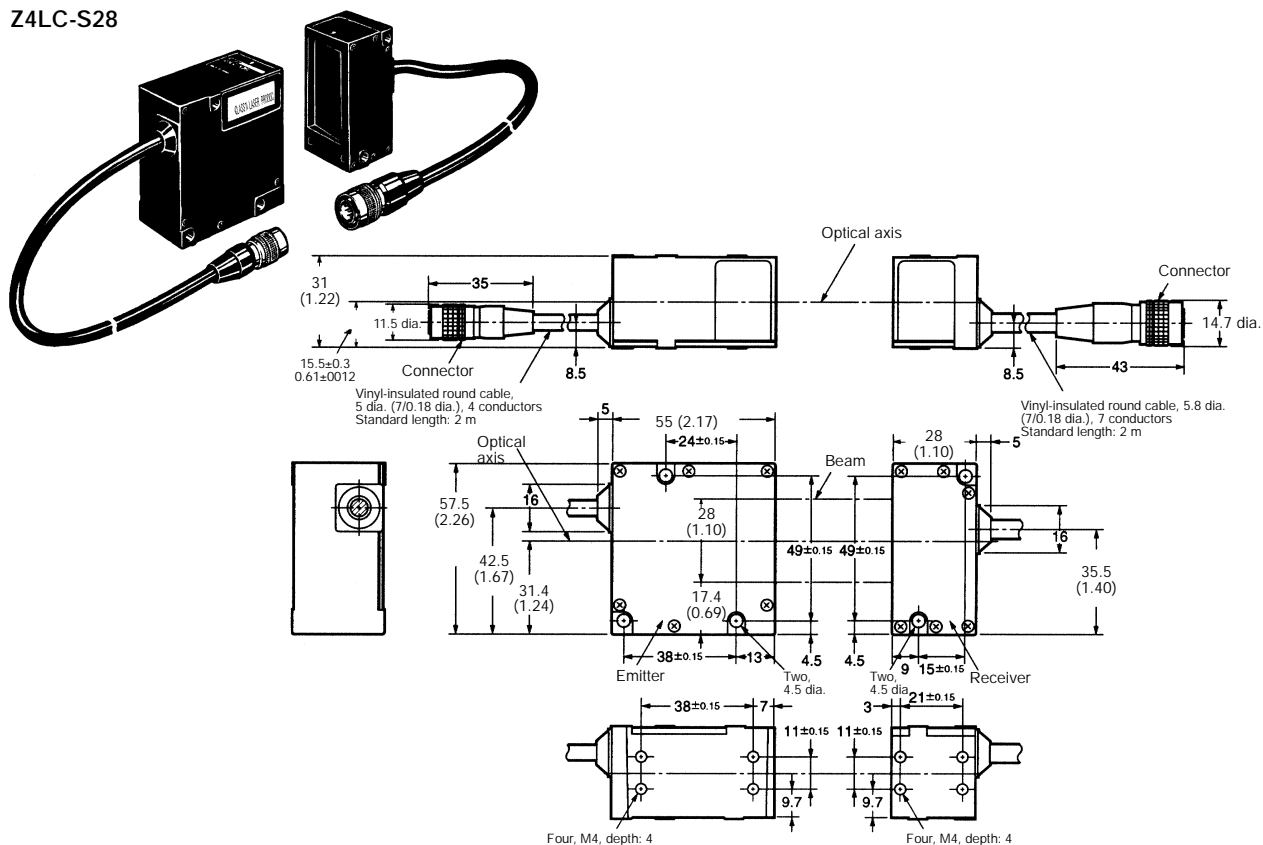

Z4LC

OMRON

Z4LC

Precautions

The Z4LC Parallel Beam Line Sensor, is a Class 1 Laser Product according to EN60825 (IEC825) and JIS C6802 and a Class II Laser Product according to FDA (21 CFR1040.10) (see note). The Z4LC is meant to be built into final system equipment. Pay special attention to the following precautions for the safe use of the product:

Note: Europe: Class 1 of EN60825: 1991 = IEC825: 1984 & IEC825-A1: 1990
Japan: Class 1 of JIS C6802: 1991
U.S.A.: Class II of FDA (21 CFR1040.10)

CLASS 1 LASER PRODUCT

- Use this product as specified in this datasheet, or you may be exposed to hazardous laser radiation.
- Be careful not to expose your eyes directly to the laser radiation or indirectly to laser radiation reflected from mirror or shiny surfaces.
- To avoid exposure to hazardous laser radiation, do not displace nor remove the protective housing during operation, maintenance, and any other servicing.
- The user should return the product to OMRON for all repair and servicing.
- When used in other countries, observe the regulations and standards specified by each country.

■ LABEL INDICATIONS

EN

CLASS 1 LASER PRODUCT

JIS

クラス1レーザー製品


FDA

Certification and Identification Label

TYPE Z4LC-S28
(Tc=25°C, 16 μW)
T: 3260 μsec ts: 990 μsec f: 0.306KHz
This product complies with 21 CFR 1040.10 and 1040.11
OMRON Corporation
KARASUMA NANAJO, SHIMOGYO-KU, KYOTO, 600 JAPAN
MANUFACTURED A

Aperture Label

AVOID EXPOSURE
Laser radiation is emitted from this aperture

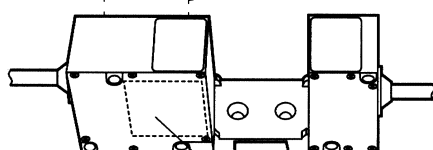

Class II Caution Label Logo Type



Note: Use of controls, adjustments, or procedures other than those specified herein may result in hazardous radiation exposure.

■ MEASUREMENT ACCURACY

To improve the measurement accuracy, place the sensing object as close as possible to the receiver.

■ COMPATIBILITY

The Sensor or Controller can be used with another controller or sensor. However, the emitter and receiver are adjusted as a set. When setting up the Sensor, be sure to set the binary level before operation.

■ MAINTENANCE

Install the Sensor in clean environment and keep the filter on the front panel of the Sensor free from oil and dust. If affected by oil or dust, clean the filter as follows.

Use a blower brush (used to clean camera lenses) to blow large dust particles from the surface. Do not blow the dust away with your mouth.

Use a soft cloth (for lenses) with a little alcohol to remove the remaining dust. Do not use a scrubbing action when cleaning as scratches on the filter could result in a Sensor malfunction.

■ ENVIRONMENT

Do not use in strong electromagnetic fields or in an environment where the operation of the Sensor is subject to the reflection of intensive light (such as other laser beams or electric arc welding machine).

The Sensor may not detect the object or the resolution may be insufficient depending on the material or shape of objects. (i.e. transparent objects, etc.)

■ MUTUAL INTERFERENCE

Sensors can be closely mounted. Do not, however, make each laser beam closer, or the Sensors may malfunction.

■ APPROPRIATE USE

The user must operate the product according to the performance specifications described in the instruction manual.

Before using the product under conditions which are not described in the manual or applying the product to nuclear control systems, railroad systems, aviation systems vehicles, combustion systems, medical equipment, amusement machines, safety environment, and other systems, machines, and equipment that may have a serious influence on lives and property if used improperly, consult your OMRON representative.

Make sure that the ratings and performance characteristics of the product are sufficient to the systems, machines, and equipment, and be sure to provide the systems, machines, and equipment with double safety mechanisms.

Z4LC

OMRON

Z4LC

■ WIRING


Do not impose voltage exceeding the rated voltage, or the Sensor may be broken.

Do not short-circuit the load supplied with open collector output, or the Sensor may be damaged.

Do not lay power supply cable for the Z4LC together with high-voltage lines or power lines to prevent interference, damage, or malfunction.

A Z49-C6 Extension Cable (2 or 8 m long) can be connected to the sensor cable or amplifier cable. The total length of the sensor cables or amplifier cables, however, must be 10 m or less. Use a shielded cable to extend the amplifier cable, in which case the same kind of shielded cable as that of the amplifier cable must be used.

Use an insulated transformer for the power supply of the Z4LC as shown in the illustration. Do not use an autotransformer or the Z4LC may malfunction.

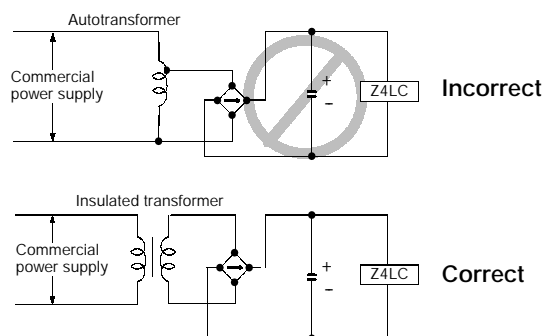

Note: The product has been produced at OMRON Ayabe which obtained ISO9001-approval for its quality system and ISO14001-approval for its environmental management system from international certification bodies.

NOTE: DIMENSIONS SHOWN ARE IN MILLIMETERS. To convert millimeters to inches divide by 25.4.

OMRON®

OMRON ELECTRONICS LLC

One East Commerce Drive
Schaumburg, IL 60173

1-800-55-OMRON

OMRON ON-LINE

Global - <http://www.omron.com>

USA - <http://www.omron.com/oei>

Canada - <http://www.omron.com/oci>

OMRON CANADA, INC.

885 Milner Avenue
Scarborough, Ontario M1B 5V8

416-286-6465